

MANN-FILTER

Product Information

N 112
19/07/2017

Installation of fuel filter WK 720

In some cases a humming noise can be heard from the area of inline fuel filter WK 720 after changing.


What is the cause of this noise?

This noise is mostly caused by air entering the system during the filter change. To prevent this, please carefully follow the steps described below when changing the filter:

How should be proceed when changing the filter?

1. Open fuel filter cap to release pressure.
2. Pinch off all fuel lines with appropriate tools before disconnecting. This avoids air from entering into the system.
3. Remove all fuel lines from the used filter and connect to the new filter. When connecting the new filter, please note the flow direction mark on the filter and do not switch fuel lines. Broken fuel lines or clamps must be replaced.
4. Test connections for leakage.

! Please put on protective clothing within the change of the filter!

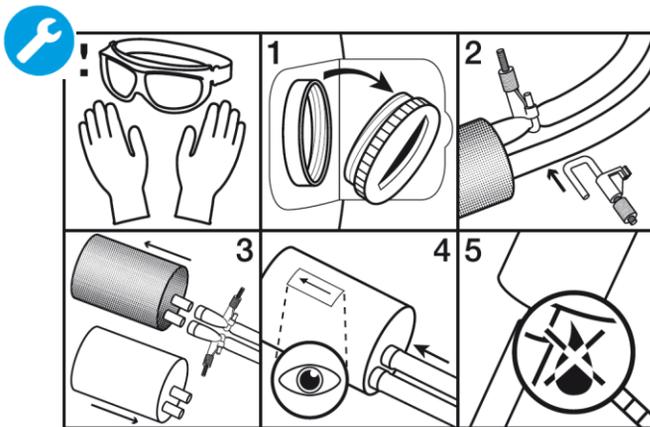

Should the humming noise still occur despite the described installation procedure, it may originate from the fuel delivery system. In this case please check fuel pump, the tank vent and pre filter.

